



Test Products International, Inc.  
9615 SW Allen Blvd., Ste. 104  
Beaverton, OR 97005  
Tel: 503-520-9197  
www.testproductsintl.com

Test Products International, Ltd.  
342 Bronte Road South, Unit #6  
Milton Ontario Canada L9T  
5B7 Tel: 905-693-8558  
www.tpicanada.com

Test Products International Europe Ltd.  
Rutherford Way Industrial Estate  
Rutherford Way  
Manor Royal  
Crawley  
West Sussex  
RH10 9LN  
www.tpieurope.com

### 319C Pocket Digital Thermometer

To measure temperature, follow these simple instructions:

1. Remove the protective sheath from the stem.
2. Press the ON/OFF button.
3. Touch the tip to a surface to measure the temperature.

### Selecting Fahrenheit or Celsius mode:

With the unit "OFF" press and continue to hold the ON/OFF button. The LCD will alternate between °F and °C. Release the ON/OFF button when desired measurement mode appears on the LCD.

### Data Hold:

The Data Hold function is used by pressing the D-H button when taking a measurement. The measurement will flash on the LCD when Data Hold is in use. To release the D-H button a second time. Press the ON/OFF button to end operation, or the unit will automatically power off after 35 minutes.

### Specifications:

Range -58° to 300°F/-50° to 150°C  
Resolution 0.1 °F/C  
Accuracy  $\pm 2^\circ\text{F}/\pm 1^\circ\text{C}$   
Sampling Time 1.5 seconds  
Battery 1.5 Volt Button (SR44 / LR44)

This Instrument is in compliance with EN 50 081-1:1992, EN 50 082-1:1992, IEC 801-2:1984, IEC 801-3:1984, IEC 801-4:1988

### TPI 319C FIELD CALIBRATION

Fill a plastic or metal container with crushed ice and add clean water to a depth of at least 4 inches. Stir the ice and water for 2 to 3 minutes prior to performing calibration to ensure the water is completely chilled. Make certain there is plenty of ice in the mixture and always use clean water. Distilled water works well. The temperature of an ice bath is approximately 32°F (0°C).

Insert the stainless steel shaft of the 319C into the ice bath making sure at least one inch of the tip is immersed. Allow the reading on the thermometer to stabilize.

Press and hold the **D-H** button for approximately 8 seconds until "CAL" is displayed. "CAL" will display for approximately 2 seconds and then the 319C will return to normal operation. Calibration is complete.

Note: If the temperature reading was not within 23°F to 41°F (-5°C to 5°C) when step 3 was performed no change in calibration occurred. The 319C was designed with this feature to prevent improper calibration.

